

# MARION COUNTY SURVEYOR'S OFFICE


## SECTION CORNER RECORD

DEBRA S. JENKINS  
MARION COUNTY SURVEYOR

SEC. 35 TWN. 15<sub>N</sub> RNG. 2<sub>E</sub>

BRYAN F. CATLIN, PLS  
TECHNICAL SUPERVISOR

Date: 5-21-09  
Party Chief: Wilcoxen  
Crew: Taylor / Finney  
Type of Marker: Survey mark nail  
Method of Establishment: County: 3-17-95  
IN S.P.C. E Zone, NAD 83  
Name: 15023505  
N: 494 227.926 9(m)  
E: 47 494.265 0(m)

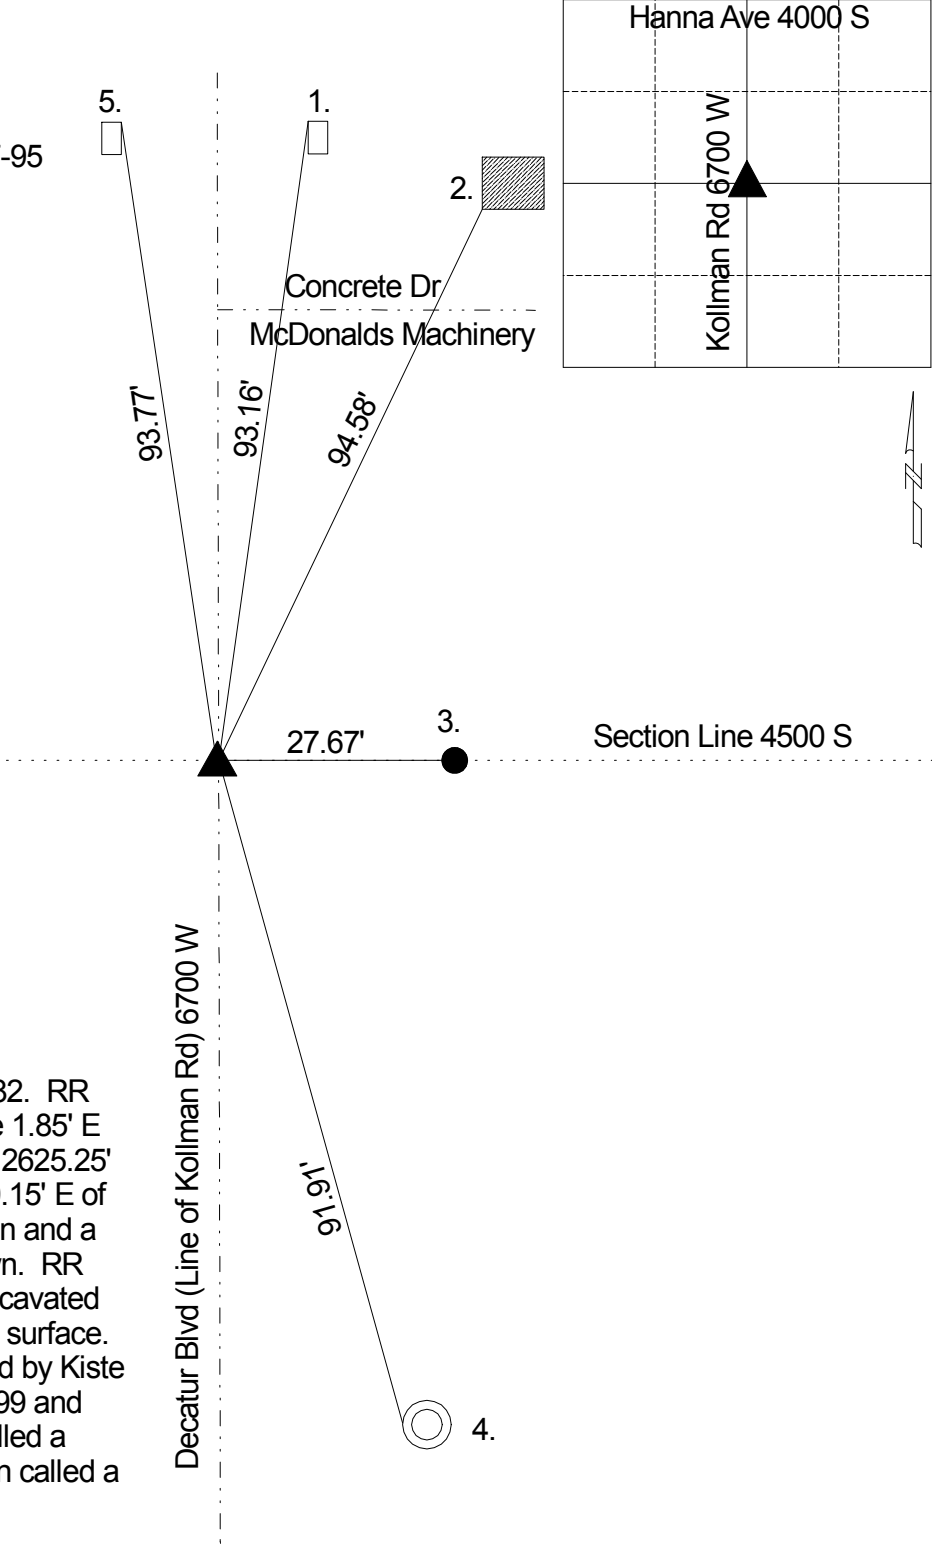

Corner excavated by Cleveland 5-12-1982. RR spike found at surface. Spike found to be 1.85' E of a line connecting N/S 1/4 corners and 2625.25' N of 1/4 corner. Stone found 12" down 0.15' E of the spike. Excavated 5-11-93 by Wilcoxen and a PK nail Fd at surface. Stone Fd 12" down. RR spike set at surface after excavation. Excavated 3-17-95 by Wilcoxen and RR spike Fd at surface. Stone Fd 12" down. Harrison set. Re-tied by Kiste 5-27-99. Road construction between 1999 and 2004 demolished Harrison. Wilcoxen called a survey mark nail on 6-29-2004. Wilcoxen called a survey mark nail on 5-21-2009.

REF.	DISTANCE	DESCRIPTION
1.	93.16'	Cut 'x' NW corner of storm inlet rim
2.	94.58'	SW corner concrete base of stone address
3.	27.67'	Mag nail in curb joint
4.	91.91'	Cut 'x' W-rim Ameritech manhole
5.	93.77'	Cut 'x' NE corner storm inlet rim

THIS CORNER POSITION REPRESENTS A "TITLE" CORNER AND MAY NOT NECESSARILY REPRESENT THE POSITION BASED ON RECORD CORNERS.